


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Bamford Robb, deputy surveyor, under G.L.O. contract No. 357 dated July 2, 1880. Surveyor general's record states: North between Sections 1 and 6. VA. 18°45'East.

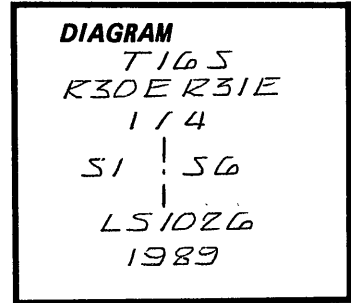

C-1
F.B. 6 P. 6,7

40.00 Set post for 1/4 Section corner with pits and mound as per instructions.

Description of corner evidence found:

No evidence of original corner found. Corner considered lost and re-established by survey. Corner position falls in middle of cultivated meadow hay field.

Description of monument and accessories | established to perpetuate the original location of this corner:

At proportionate position as determined by survey, set a 2-1/2"O.D. x 30" long aluminum pipe 36" in ground with a 2-1/2" diameter aluminum cap marked as shown 6" below surface of wild hay meadow:

Set Reference Monuments:

A 1"x24" long iron rod bears South 70°35'24" West, 367.70 ft., stamped "RM S1 LS1026 1989"; A 1"x24" long iron rod bears South 18°45'16" East, 223.05 ft., stamped "RM S6 LS1026 1989"; Set a steel post 1 ft. from each RM on line from cap extended with sign 54-9 facing cap; Southeast RM at Northeast corner of stackyard; Traverse point, a 5/8" iron rod with yellow plastic cap flush with ground bears North 00°02'54" East, 23.61 ft.

I hereby certify that the above corner monument was re-established as herein described on October 12, 1989.

Witnesses: David B. Armstrong

See C.S. #1122

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong

12/12/89 OREGON
AUGUST 22, 1975
DAVID B. ARMSTRONG
1026

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 13 day of Feb, 1990
Roberto Bago by _____
(COUNTY OFFICIAL) (DEPUTY)