


CORNER RESTORATION

CORNER N 1/4 cor.
Sec. 35 TWP 16 S. RANGE 31 E. W.M.

ORIGINAL SURVEY BY: S. W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

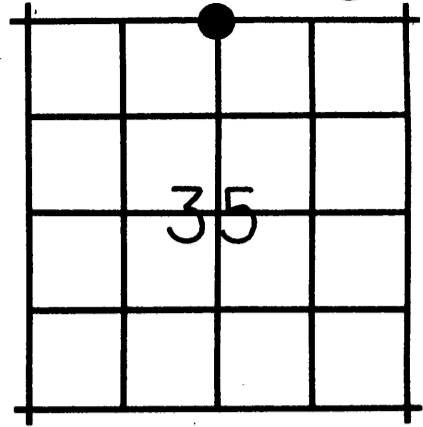

ORIGINAL DESCRIPTION:

Set post for 1/4 sec. cor. with pits and mound as per instructions.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
G. T. Blackman
J. L. Watson

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

July 28, 1983

RECEIVED AND
FILED

AUG 16 1983

OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
Attest: *Carol Knight, Clerk*

EVIDENCE FOUND:

I found no physical evidence of the 1/4 corner. Bear Creek which flows through this area has changed courses many times and I could not place this corner by topography calls to the creek. Although I tried to sort out where the channel was in 1880, I could not conclusively determine the corner position. I therefore declared the corner lost and set the following described monument at single proportionate measure between the found and accepted NE and NW corners of Sec. 35.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point:

Set a 1 1/2"x30" galvanized iron pipe 42" in the ground with brass cap marked as shown.

I set a 5 ft. steel fence post 2 ft. South of the monument and attached a B-G-A Bearing Tree tag to it.

A fence corner of fences running E & S bears S. 6° W., 38 ft.

This corner is in a pasture.

See Map of Survey No. 779.

MONUMENT MARKED

