


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:  
Corner not previously established.

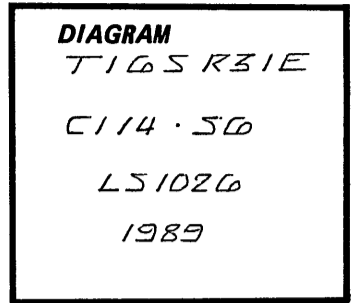

C-3  
F.B. 6 P. 66,67

Description of corner evidence found:  
None. Corner not previously established.

Description of monument and accessories established to perpetuate the original location of this corner:

At position as determined by survey set a 2-1/2"O.D.x30" long aluminum pipe 22" in ground to bedrock with a 2-1/2" diameter aluminum cap marked as shown: Raised a 2-1/2 ft. diameter stone mound to cap.

Marked bearing trees:

A 14" Ponderosa Pine bears South 88-1/2° West, 16.3 ft., scribed "C1/4S6BT"; a 9" Ponderosa Pine bears South 10-1/2° East, 42.0 ft., scribed "C1/4S6BT". Painted a 6" red band and face blazes red. Nailed signs 54-9 and 54-3 to BT'S. Nailed a brass washer stamped "LS 1026" to face blazes of BT'S. Set a steel fence post 5 ft. East of cap with sign 54-9. Bearings are by staff compass and declination is 19-1/2° East.

I hereby certify that the above corner monument was re-established as herein described on October 12, 1989.

Witnesses: David B. Armstrong

See C.S. #1122

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*David B. Armstrong*

12/12/89 OREGON  
AUGUST 22, 1975  
DAVID B. ARMSTRONG  
1025

Office of Surveyor County of Grant  
State of Oregon, I hereby certify that the within instrument was filed in this office  
for record on the 13 day of Feb, 1990  
Robert D. Bugh by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)