


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Samuel Lackland, deputy surveyor, under G.L.O. contract No. 357 dated July 2, 1880, and performed that year. Surveyor general's record states: North between Sections 4 and 5 Va. 18°45' East

- 40.00 Set post for 1/4 section corner with pits and mound as per instructions.
- 40.75 Brook 2 links wide flows southwest.

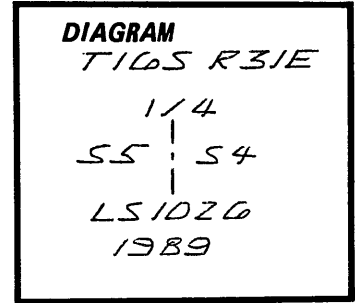

C - 9
F.B. 8 P. 74,75

Description of corner evidence found:

At assumed corner location found North-South-West fence corner with large rock crib 4 ft. x 4 ft. x 3 ft. high southwest at fence corner. Examination indicated fence corner maintained and rebuilt at this location several times. Land owners indicated that fence corner has been so located for many years, and accepted as the corner. My initial proportioning indicated that the fence corner is harmonious with the original survey and fell within 10 ft. of the proportioned location. Because of the long acceptance of this corner and harmonious relationship with other corners of the original survey, I determine to accept the fence corner as a perpetuation of the original corner and so remonument. The stream is now 6 ft. North but has meandered South over the years.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position of accepted fence intersection, set a 2-1/2"O.D.x30" long aluminum pipe 28" in ground with a 2-1/2" diameter aluminum cap marked as shown: No stone available for mound.

Marked bearing trees:

A 13" Ponderosa Pine bears South 83-1/2° East, 30.8 ft., scribed "1/4S4BT"; a 15" Ponderosa Pine bears North 14° West, 95.5 ft., scribed "1/4S5BT". Painted a 6" red band and face blazes red. Nailed signs 54-9 and 54-3 to BT'S. Nailed a brass washer stamped "LS 1026" to face blazes of BT'S. Set a steel fence post 5 ft. North of cap with signs 54-9 and 54-2. Bearings are by staff compass and declination is 19-1/2° East.

I hereby certify that the above corner monument was re-established as herein described on November 8, 1989.

Witnesses: Wes G. Heigh
Paul D. Woodworth

See C.S. #1123

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David B. Armstrong

12/22/89 OREGON
AUGUST 22, 1975
DAVID B. ARMSTRONG
1026

Office of... Surveyor County of... Grant

State of... Oregon, I hereby certify that the within instrument was filed in this office
for record on the... 13 day of... Feb, 19... 90

... Robert D. Bayne by (DEPUTY)

(COUNTY OFFICIAL)