


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-17

**History of original corner establishment:**

Corner originally established by F. W. Campbell under Contract No. 380 dated March 19, 1881. Notes state: Set a basalt stone 22 x 10 x 7 and raised mound of stone for cor. to secs. 22, 23, 26, 27. Corner was re-established by William R. Wells, in Grant County Map of Survey No. 599. Record states: At the corner position a 2" x 30" iron pipe with brass cap was set 12" in the ground and surrounded with a mound of stones to cap.

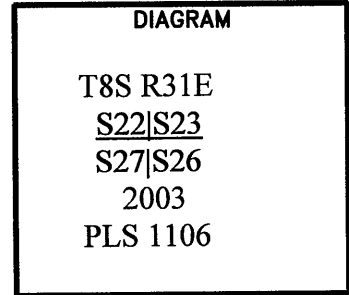

Set 4 reference monuments, 2" x 30" iron pipes with brass caps, surrounded by stone mounds to cap: A RM set 12" in the ground bears N47 1/2°W 45.13 ft marked T8S R31E S22 RM 45.13 ft 1979 PLS 1106. A RM set 12" in the ground bears N 58°E 51.37 ft marked T8S R31E S23 RM 51.37 ft 1979 PLS 1106. A RM set 8" in the ground bears S56°E 43.16 ft marked T8S R31E S26 RM 43.14 ft 1979 PLS 1106. A RM set 8" in the ground bears S44°W 48.54 ft marked T8S R31 E S27 RM 48.54 ft 1979 PLS 1106.

**Description of corner evidence found:**

Found 2 1/2" galvanized iron pipe with 3" brass cap projecting 12" from stone mound. This monument, re-established for the corner on Map of Survey No. 599, in 1979, was rejected due to new evidence found.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Will. R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

*renews 6-30-06*

**Description of monument and accessories I established to perpetuate the original location of this corner:**

I establish the corner point by survey and set a 2 1/2" by 30" aluminum pipe with 2 1/2" aluminum cap, marked as shown in Diagram, 20" in the ground and surrounded with a mound of earth and stone. Set steel fence post 3' East of corner and attached sign 54-9. I change the rejected 1979 monument to a reference monument. The reference monument is marked: "RM, T8S R31E, 14.2 FT →, 2003, PLS 1106". The reference monument bears South 25°21' East, 14.2 feet from the new corner monument.

I revise the four existing 1979 reference monuments, (3" brass caps on 2 1/2" galvanized iron pipes surrounded by stone mounds), to reference the new corner point. From new corner point: RM bears N 76°04' E, 52.5 feet, marked "T8S R31E S23 RM ← 52.5 FT 2003 PLS 1106". RM bears S 50°38' E, 55.5 feet, marked "T8S R31E S26 RM ← 55.5 FT 2003 PLS 1106". RM bears S 25°37' W 55.3 feet, marked "T8S R31E S27 RM 55.3 FT → 2003 PLS 1106". RM bears N 59°57' W, 32.8 feet, marked "T8S R31E S22 RM 32.8 FT → 2003 PLS 1106". Reference monuments have a steel fence post set near each reference monument with sign 54-9 attached.

This corner was monumented on April 8, 2003. Bearings and distances to reference monuments were measured with infra-red total station.

Witness: Jason Wells, LSIT

Office of SURVEYOR County of GRANT  
State of OREGON, I hereby certify that the within instrument was filed in this office for record on the 12 day of AUG, 2004  
Grant D. Baggett by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)