


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

None

Index No. P-3

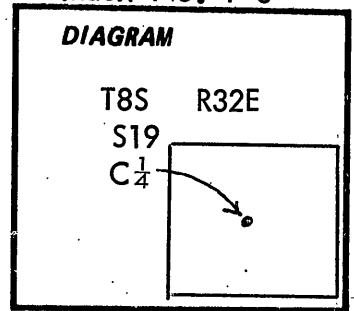

No record of subsequent remonumentation found in County Records.

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner:

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 24 inches in the ground and surrounded with a mound of stones to the cap.

Set a steel fence posts South and West of the corner and attached signs 54-2 and 54-9.

Established 2 new BT's:

A 10" Fir bears N88 $\frac{1}{2}$ $^{\circ}$ W 32.1 feet scribed C $\frac{1}{4}$ S19 BT

A 12" Fir bears N37 $\frac{1}{2}$ $^{\circ}$ E 29.8 feet scribed C $\frac{1}{4}$ S19 BT

New BT's have a lower blaze scribed BT with brass washer stamped PLS 1106 nailed flush.

Attached signs 54-3 and 54-4 to all BT's and painted a red ring around the trees above the upper blaze.

Used steel tape and magnetic compass with 19 $\frac{1}{2}$ $^{\circ}$ east declination. Measured to center of BT's.

See map of survey.


This corner set November 6, 1979

Witnesses: D. Kaufman, PLS
B. English

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

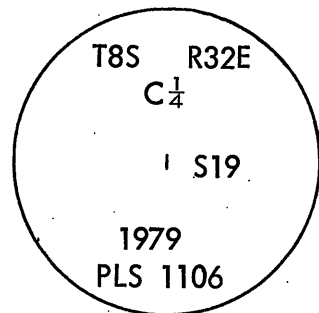

Office of... County Surveyor..... County of... Grant

State of... Oregon..... I hereby certify that the within instrument was filed in this office

for record on the... 9... day of... Jan... 1980

Robert D. English by (DEPUTY)

(COUNTY OFFICIAL)