


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

None

Index No. Q-4

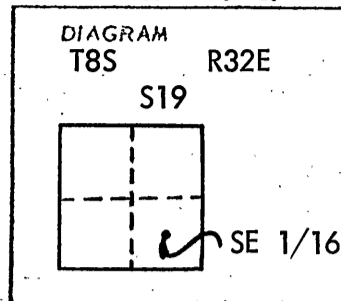

No record of subsequent remonumentation found in County Records .

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 30 inches in the ground.

Set steel fence posts South and West of corner and attached signs 54-2 and 54-9.

Established 2 new BT's:

A 10 1/2" Fir bears S12 1/2° E 63.0 feet scribed SE 1/16 S19 BT

A 11" Fir bears S65° E 85.6 feet scribed SE 1/16 S19 BT

New BT's have a lower blaze scribed BT with brass washer stamped PLS 1106 nailed flush.

Attached signs 54-3 and 54-4 to all BT's and painted a red ring around the trees above the upper blaze.

Used steel tape and magnetic compass with 19 1/2° east declination. Measured to center of Bts.

See map of survey


This corner set November 5, 1979

Witnesses: D. Kaufman, PLS
B. English

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

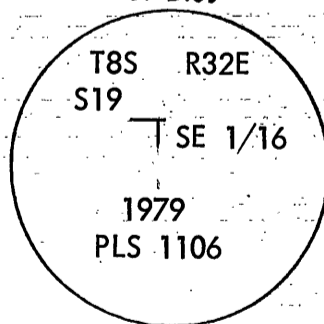

Office of County Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 9 day of Jan 1980
Robert D. Bayett by _____
(COUNTY OFFICIAL) (DEPUTY)