

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-1


History of original corner establishment:

F.W. Campbell under G.L.O. Contract No. 380, dated Mar. 19, 1881, set a basalt stone 18"x 8"x 8" and dug pits.. From the corner:

- A Tamarack, 20" dia., S88°E, 32 lks.
- A Pine, 20" dia., N80°W, 30 lks.

In 1974, Leland Myers, PLS 699, found the original stone and the NW BT. He set a 2"x 30" iron pipe with a 2 1/2" brass cap marked:

- From the corner:
- A Douglas Fir, 34" dia., N80°W, 20.8 ft.; orig. BT
 - A White Fir, 14" dia., S58°W, 73.2 ft.
 - A White Fir, 12" dia., S42°E, 41.1 ft..
 - A White Fir, 12" dia., N75°E, 51.3 ft.

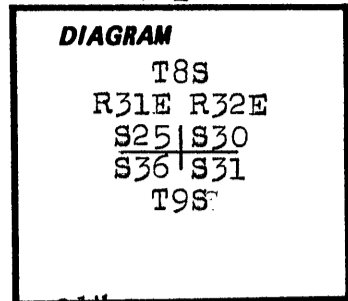

```

T8S
R31E R32E
S25|S30
S36|S31
OPLS 699
1974

```

Description of corner evidence found:

I found a 2" iron pipe with a 2 1/2" brass cap marked as above.. Monument is in mound of stone.. From the corner:

- A badly burned stump, approx. 3' dia., N80°W, 20.8 ft.
- A White Fir, 19" dia., N62 3/4°W, 72.5 ft.; scribing visible.
- A White Fir, 16" dia., N76°E, 51.6 ft.; scribing visible..
- A White Fir, 15" dia., S44°E, 41.1 ft.; scribing visible.

Description of monument and accessories I established to perpetuate the original location of this corner:

I marked a new BT:

A Douglas Fir, 19" dia., N65 3/4°W, 52.6 ft.; marked: T8S R31E S25 BT
BTs have blaze and a 6" band painted red, BT tags and "Land Survey Monument" signs. New BT has, additionally, an alum. "PLS 1832" washer nailed to the bottom of the blaze. There is a 6' steel fence post with a "Land Survey Monument" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 18°E.

Sep. 23, 1991

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Fayette S. Munro

OREGON
JULY 13, 1979
FAYETTE S. MUNRO
1832

Office of Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 12 day of Nov, 1991
Robert D. Baggett by _____
 (COUNTY OFFICIAL) (DEPUTY)