


CORNER NOTES

- 6A) Reset 2 1/2" brass cap on iron pipe and changed the date as shown.
BTs: 11" Ponderosa Pine bears S 50° W, 30.6 ft., scribed N1/16 S21 BT, with washer "PLS 1918".
12" Ponderosa Pine bears S 44° E, 6.5 ft., scribed N1/16 S22 BT, with washer "PLS 1918".
- 7A) Reset 2 1/2" brass cap on iron pipe and changed the date as shown.
BTs: No trees within range (300 ft.)
- 8A) Reset 2 1/2" brass cap on iron pipe at original distance and direction from found original BT, and changed the date as shown.
BTs: Stump of original BT, fragmentary scribing visible, bears N 5° E, 142.56 ft. (216 lks).
18" Ponderosa Pine bears S 83° W, 58.6 ft., scribed T16S R32E S21 BT, rescribed to T16S R32E S28 BT, with washer "PLS 1918".
11" Ponderosa Pine bears N 39° E, 103.4 ft., scribed T16S R32E S22 BT, with washer "PLS 1918".
- 12A) Reset 2 1/2" brass cap on iron pipe and changed date as shown.
BTs: 26" Ponderosa Pine bears N 66° E, 22.7 ft., scribed CN1/16 S22 BT, with washer "PLS 1918".
11" Ponderosa Pine bears S 78° W, 40.3 ft., scribed CN1/16 S22 BT, with washer "PLS 1918".

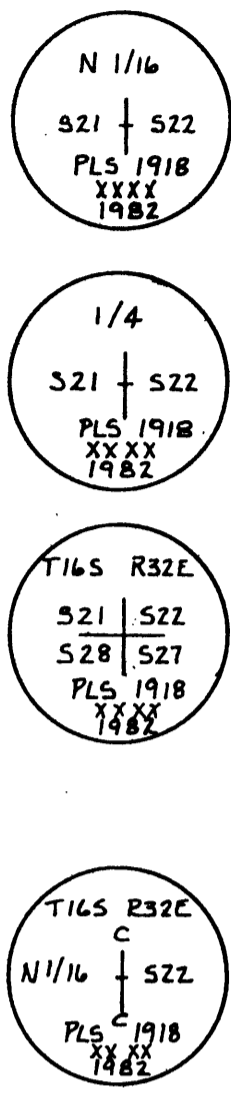

NARRATIVE

This plat amends and corrects the plat recorded as CS 638, as filed in the Grant County Surveyor's Office due to the discovery of an original Bearing Tree to the southwest corner of Section 22 by Mr. Robert D. Bagett, Grant County Surveyor. Work was performed for the United States Forest Service under contract No. 53-Q4H1-0-8007N, Glade Cadastral Survey.

Discovery of original evidence of the southwest corner of Section 22 required the remonumentation of that corner and the resetting of the 1/4 corner to Sections 21 and 22, the N 1/16 corner to Sections 21 and 22, and the CN 1/16 corner to Section 22. Basis of Bearings was a solar observation taken near the east 1/4 corner to Section 23, taken in 1980. Sufficient control remained from the 1980 survey to reset the required corners. The southwest corner of Section 22 was remonumented at record distance and direction from the center of the stump of the found original Bearing Tree. Positions of the other corners were then calculated and those corners reset. Monuments from the 1980 survey were removed from the ground and reused after changing the date. Additional search was made for the 1/4 corners to Sections 21 and 22, and to Sections 27 and 28, without result. The original monument at the southwest corner of Section 22 was searched for but not found.

The plat, corner notes, and narrative of CS 638 remain valid, except as changed by this plat.

SURVEYOR'S CERTIFICATE

I, Tyler B. Parsons, a Registered Land Surveyor in the State of Oregon, hereby certify that this plat, and the notes hereon or attached, are a correct representation of a survey I performed for the U.S. Forest Service during October 1982, in accordance with the Statutes of the State of Oregon and the articles of my contract.

RECEIVED AND FILED

NOV 23 1982

OFFICE OF COUNTY SURVEYOR
Robert D. Bagett
Attest: *Shirley Lawrence*

REGISTERED PROFESSIONAL LAND SURVEYOR
Tyler B. Parsons
OREGON
JULY 18, 1980
TYLER B. PARSONS
1918

REVISIONS	BY

AMENDMENT TO COUNTY SURVEY NO. 638
for the United States Forest Service, located in
Section 22, T 16 S, R 32 E, W.M.
Grant County, Oregon

MSS Inc.
P.O. Box 1688
Corvallis, OR 97339
(503) 757-0861

Date	16 November 1982
Scale	1" = 1000'
Drawn	TBP
Job	J-115 / G-253
Sheet	1
Of	1 Sheets